

**Qwest Corporation** 

1020 Nineteenth Street, NW, Suite 700 Washington, DC 20036 Phone 202 429.3136 Facsimile 202.296.5157

Kenneth T. Cartmell
Executive Director - Federal Regulatory

July 27, 2000

Mr. Dale Hatfield Chief, Office of Engineering and Technology Federal Communications Commission 445 12<sup>th</sup> Street, SW, Room 7-C155 Washington, DC 20554

RE:

CFR 47, Section 63.100

Final Service Disruption Report, Flagstaff, Arizona

FLGSAZMADS0

Dear Mr. Hatfield:

On June 27, 2000, Qwest<sup>1</sup> experienced a Service outage in Flagstaff, Arizona. In accordance with the reporting rules, CFR 47, Section 63.100, enclosed is Qwest's Final Service Disruption Report for this outage.

Please contact me if you have questions concerning this report.

Sincerely,

Attachments

CC:

Mr. Robert Kimball

uneth I artmell

Mr. Doug Sicker

<sup>&</sup>lt;sup>1</sup> On June 30, 2000, U S WEST, Inc., the parent and sole shareholder of U S WEST Communications, Inc., merged with and into Qwest Communications International Inc. Further, on July 6, 2000, U S WEST Communications, Inc. was renamed Qwest Corporation.

# **Final Service Disruption Report**

Reporting Company: Qwest<sup>1</sup>

Location of Disruption: Flagstaff, Arizona FLGSAZMADS0

## Date and Time of Incident:

June 27, 2000 at 2330 MDT.

## 2. Geographic Area Affected:

The Central Offices serving Flagstaff Main (FLGSAZMADS0), Flagstaff South (FLGAZSORS1), Ashfork (ASFKAZMARS1), Grand Canyon (GRCNAZMARS1), and Williams (WLMSAZMARS1), Arizona were affected.

#### 3. Estimated Number of Customers Affected:

Approximately 36,600 Qwest customers were affected by the outage.

#### 4A. Types of Services Affected:

InterOffice services were affected.

#### 4B. 911 Service Affected:

911 service was not affected by the event.

#### 5. Duration of Outage:

Service was restored at 0059 PDT. The total duration of the outage was 1 hour and 28 minutes.

## 6. Estimated Number of Blocked Calls:

There were approximately 8,900 blocked calls.

#### 7A. Root Cause of the Incident:

- The root cause of the incident was an error in a Method of Procedure (MOP).
- On June 27, 2000, the Central Office Technician (COT) in the Flagstaff Main central office was in the process of extracting data onto tape for the Qwest Information Systems organization. This process extracts data from the 5ESS switch modules onto disk files within the switch. These files are then downloaded to tape and mailed to the Qwest Information Systems organization to update their files. The COT performing the work incorrectly read the process and performed a command which removed all files from the root portions of the disks where pertinent information for operations is stored. The result of this action was isolation of the switch from SS7 and all toll service. Local call processing was not affected.

<sup>&</sup>lt;sup>1</sup>On June 30, 2000, U.S.WEST, Inc., the parent and sole shareholder of U.S.WEST Communications, Inc. merged with and into Qwest Communications International Inc. Further, on July 6, 2000, U.S.WEST Communications, Inc. was renamed Qwest Corporation.

## Page 2

## 7B. Name and Type of Equipment:

Lucent Technologies 5ESS

#### 7C. Specific Part of Network Affected:

Central Office Switch

#### 8. Method(s) Used to Restore Service:

♦ A restoration bridge with Qwest Technical Support and the vendor was activated immediately to restore the files to the root portion of the disks. It was determined that the switch would need to be reloaded from tape. Once the office was reloaded from tape, a series of 54 commands were performed to reinitialize the switch.

## 9. Steps Taken to Prevent Recurrence of Outage:

The following steps have been or will be taken to prevent recurrence of the outage:

• Use of this extraction process was suspended in this office and all other offices until NROC Technical Support and Systems could rewrite the procedures. This rewrite includes safeguards added to prevent recurrence.

## 10A. Applicable Best Practice(s):

Qwest reviewed <u>Network Reliability: A Report to the Nation</u>, June 1993 and evaluated all recommendations and best practices by focus area. Based on the root cause analysis, the most appropriate focus areas are:

Section B - Signaling Network Systems

Reference 6.1.1 -Root Cause Analysis

#### 10B. Best Practice(s) Used:

Section B - Signaling Network Systems

Reference 6.1.1 -Root Cause Analysis

## 10C. Analysis of Effectiveness of Best Practice(s):

Section B - Signaling Network Systems

Reference 6.1.1 -Root Cause Analysis

While this reference is specific to Signaling networks, Qwest currently requires a root cause analysis on all significant network failures.

#### **Contact Person:**

Kenneth Cartmell, Executive Director - Federal Regulatory Qwest 1020 19th Street, NW, Suite 700 Washington, D.C. 20036 Telephone (202) 429-3136

# FCC INITIAL REPORT

# U S WEST - Large Scale Abnormal Condition Report (LSACR) Service Disruption Report

[ ] 120 MINUTE REPORT [X] 3 DAY REPORT	ACR #: AZ.000628.002		
Date Of Incident: O6/27/00 Time Of Incident: 28:30:51 MST  Geographic Area Directly Affacted: FLAGSTAFF ARIZONA [Cities, LATA(s), States(s)]  CLLI code(s) for affected area: FL6SA2MAASE  Estimated Number of Customers Affected: 36,5/0  [i.e. Access lines in the switch, LATA(s) or States(o)]  Types of Services Affected (e.g. Local, Toll, 800, 911, FAA, etc.): TOLC  Duration of Gutage(Hours & Minutes):   HR 28 Minutes and 20 Seconds  Estimated Number of Blocked Calls: 3,560  Apparent Cause of Incident: Under Invisingation  Method Used to Restore Service: Unknown  Steps Taken to Prevent Recurrence: Under Invisingation			
		CONTACT PERSON: Kenneth Cartmell-Exec. Dir- U S WEST 1020 19th Street NW Suite 7	
		Tim Mason	-or- Dave Rygh
		Vice President - NROC Ph: (303) 707-5100	Director - Network Management Center Ph: 303-707-5608
		U S WEST 700 W. Mineral, Littleton, CO 80120	U S WEST 700 W. Mineral, Littleton, CO 80120
		Date Reported to FCC: 06/25/00	Time Reported to FCC: 09:05 msT
		Person Faxing Report: Manuel Baldivia	(Include AM/PM, Time Zone) Time Confirmed with FCC:
		Telephone Number: 800-879-1200 \$ 2	FCC Contact Name:
		PRI FAX: Monitoring Watch Officer (202 Secondary FAX: Monitoring Watch Officer (30 (To be used only at the direction of the Pr Also FAX to: U S WEST Federal Relations Office Also FAX to: Kuren Eccli/Jane Quigley (303) 70 Also FAX to: Glenda Weibel (206) 345-2129 Also FAX to: Bev Sharpe (303) 694-1719	71) 725-2521 - Confirm at (301) 725-2278 Timary Fax Monitoring Watch Officer)

Form Issue Date: 01/25/00